



WHEN ACCURACY IS THE POINT.™

HT-4000

THERMO-HYGROMETER
Owner's Manual Versions 1.0, 1.1



DELMHORST EUROPE
TITANIUMLAAN 100
NL 5221 CK 's-HERTOGENBOSCH
THE NETHERLANDS

info@delmhorst.eu
www.MoistureMetersDelmhorst.com
+31 (0)73 6395080

GENERAL DESCRIPTION & FEATURES

Thank you for your purchase of Delmhorst Instrument Co's newly designed **HT-4000** handheld thermo-hygrometer. The **HT-4000** offers the latest in features and functionality. , The meter is easy to operate, measures ambient temperature, relative humidity, and calculates dewpoint, absolute humidity (grains per pound), and vapor pressure. We recommend that you read the following pages in detail to take full advantage of all that the **HT-4000** has to offer.

Specifications:

- Measures RH over the range of 0-100% (with accuracy of +/- 2% over 10%-90%)
- Measures temperature over the range of -40°F-255°F with accuracy of +/- 1.8°F over -4°F to 158F (range of -40°C - 124°C with accuracy of +/- 1°C over -20° to 70°C)
- Calculates Dew Point over the range of -40°F - 176°F (-40°C - 80°C)
- Calculates GPP (Grains Per Pound) when in Fahrenheit mode over the range of 0.1-3820 GPP
- Calculates GPK (Grains Per Kilogram) when in Celsius mode over the range of 0.01-545 GPK
- Calculates PSI (Pounds Per Square Inch) when in Fahrenheit mode over the range of 0-7 PSI
- Calculates KPA (Kilopascals) when in Celsius mode over the range of 0-47 KPA
- Operating temperature - -4 to 158F (-20 to 70C)
- [Sensors - RH/T-S1 for water damage/restoration and general industrial applications; RH/S2 for in-situ concrete floor slab testing \(ASTM F2170\)](#)

Features:

- Detachable RH Sensor with optional extension cable (RH/T-C1)
- LCD backlit display
- 9V battery (included)
- 1-year warranty
- Carrying Case (included)

OPERATING INSTRUCTIONS

-USER GUIDE-

This guide provides step-by-step instructions on powering up, using and powering down the meter.

NAVIGATION:

The meter uses an on-screen, menu-driven approach to navigate through the meter features, allowing for an intuitive understanding of keypad functions. Each screen presents the user with a number of selectable options. One of the options is always selected and the user can move (navigate) the selection to any other available option. The keypad is aimed at providing navigational control, and not at accessing specific features. There are four directional keys aligned intuitively around a middle (fifth) key (see Figure 1): Above (UP), below (DOWN), to the right (RIGHT) and to the left (LEFT). The middle key is used to SELECT the option highlighted on the screen. For purposes of this owner's manual, the five keys will be referred to as ← → ↑ ↓ and SELECT.



Fig. 1 Keypad Layout

INSTALLING THE BATTERY:

The battery compartment is located on the underside of the case, at the bottom of the handle.

1. Open the battery compartment by sliding the lid back while pressing on the release indent.
2. Ensure correct polarity, and push the battery in flush with the bottom board until the connectors snap together on both sides.
3. Replace the battery compartment lid.

LOW BATTERY:

The meter features a battery status monitor, designed to warn the user as well as protect measurement accuracy from impending battery failure conditions. The battery warning is triggered by either continuous or temporary low voltage conditions. Visible (a battery icon on the top right side of the display) and audible (buzzer warble) indicators accompany a battery warning.


Once a permanent low battery condition is detected, all measurement functions are disabled. Enough power remains for other menu functions, but almost any user action at this time causes a low-battery warning to be generated. The battery should be replaced immediately. If the battery reaches critical levels, the meter will refuse to stay on at power-up.

This gradual warning system is intended to provide the user advanced battery status notice and give ample time for replacement before operational limitations occur.

METER USE

TO POWER THE METER ON:


1. Before turning on the meter, firmly insert the sensor into the top of the meter, making sure to align the pin-out on the DIN connector.
2. **To turn the meter on, press and hold the SELECT** button for approx. 2 seconds. The first screen will temporarily display the meter name (HT-4000) and the software revision level. Refer to this revision number whenever you call Customer Service.
3. The meter will display the main **RH Measurement screen**, as shown below:

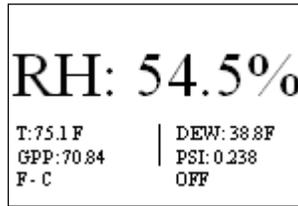

4. **The meter will begin taking readings.** As a default setting the RH reading will be the most prominent on the screen. If you would like to make another variable (temperature, GPP/GPK, PSI/KPA or dew point) the prominent reading, use the \uparrow \downarrow and \leftarrow \rightarrow keys to highlight your selection. Press the **SELECT** key to choose that variable.


TO POWER THE METER DOWN:

1. To power the meter down, highlight OFF using the \uparrow \downarrow and \leftarrow \rightarrow keys, and press SELECT.
2. Alternatively, if no keys are pressed for 2 minutes, the meter will power down automatically.

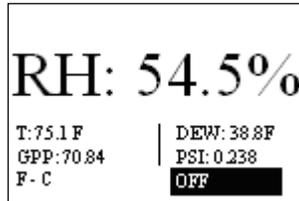


FAHRENHEIT / CELSIUS MODE TOGGLE

1. To switch between Fahrenheit and Celsius measuring modes, use the ← → ↑ ↓ keys to highlight F-C.
2. Pressing SELECT will toggle between Fahrenheit (degrees F, GPP, PSI) and Celsius.(Degrees C, GPK, KPA) modes

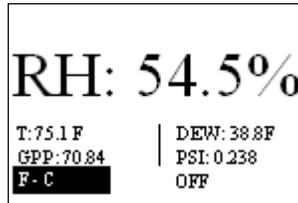

TO HOLD METER READINGS ON-SCREEN

1. To hold a reading on-screen while in measuring mode, press the SELECT key.
2. Press the SELECT key again to resume taking continuous readings.

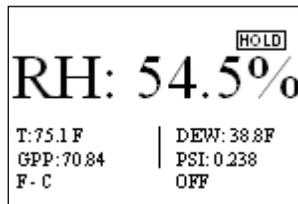

MEASURING RELATIVE HUMIDITY IN CONCRETE FLOOR SLABS IN ACCORDANCE WITH ASTM STANDARD F2170 – USE SENSOR RH/T-S2:

Select test locations to provide information about moisture distribution across the entire concrete slab, especially areas of potentially high moisture, or if the slab is thick (>4 in.) and air circulation is poor. For slabs on-grade and below-grade, include a test location within 3ft of each exterior wall. Perform minimum three tests for the first 1000 ft sq and at least one additional test for each additional 1000 ft sq.

1. Drill a 5/8" hole to a depth of 40% of the slab thickness using a rotary hammer drill. Use a drill bit specially designed for rotary drills and with 3 or 4 cutting edges to insure a smooth, round hole. Surface preparation is not required.
2. Vacuum the hole thoroughly, then use a wire brush to clean and loosen any concrete remaining in the hole. Vacuum again and repeat the process a second time.
3. Insert the yellow sleeve into the hole. Use silicone (or other water-resistant sealant) to seal the interface between the collar of the sleeve and the concrete surface. Use a hammer to insure the sleeve is fully inserted into the hole and sealed to the concrete.
4. Insert the protective yellow cap into the sleeve and let the hole acclimate for 72 hours.
5. Remove the cap and immediately insert the sensor to full hole depth. Wait minimum 1h and then take RH readings by connecting one end of the RH/T-C1 cable to the top of the meter and the other end to the exposed connector on the sensor housing. Check for drift. The meter reading must not drift more than 1% RH over 1 hour.
6. Alternately, insert the RH sensor into the sleeve immediately after setting the sleeve. Readings can then be taken as soon as the hole has acclimated.

The complete ASTM document is available at:

<http://www.astm.org/Standards/F2170.htm>

CAUTION - ABOUT THE RH/T SENSOR

Continued exposure to high temperature and humidity, chemical vapors, and any other corrosive environment will accelerate inevitable sensor aging, loss of calibration, and possible permanent damage. The sensor always must be stored inside the pouch in which it was received and in a clean, dry place when not in use. It is best to keep the meter and sensor in the carrying case. We recommend checking calibration periodically with either a "reference sensor" which is kept strictly for this purpose, or a salt solution. Both are available from Delmhorst or your supplier.

CARE OF YOUR METER

- Store your meter in a clean, dry place. The protective carrying case provided is an ideal storage place when the meter is not in use. If the meter has been left in a hot or cold environment overnight or for an extended period, allow the meter to acclimate to the temperature conditions in which it will be used for minimum 1-2 hours, or as long as possible.
- Clean the meter with any biodegradable cleaner. Use the cleaner sparingly and on external parts only. Keep cleaner out of the sensor input connector.
- After each use, place the RH/T-S1 sensor in the static-free bag it was shipped in and keep in the carrying case or a clean, dry environment.
- Remove the battery if the meter will not to be used for one month or longer.

SERVICE FOR YOUR METER

If your meter is not working properly or you believe it to be giving erroneous readings, replace the battery with a new one and/or try using a new sensor. If either of these steps does not resolve the problem:

- ✓ Pack your meter securely. Enclose a purchase order or letter with a brief description of the problem.
- ✓ There is no need to call us for a return authorization number if you are within the EU. Customers outside the EU must contact us for more specific instructions prior to returning a meter.
- ✓ Include your name, address, daytime phone and fax numbers or e-mail address. If you believe the meter is under warranty, please provide the original sales slip or invoice.
- ✓ Ship via UPS, Express Mail, Priority Mail or any overnight courier who provides prompt service. Do not use standard parcel post.
- ✓ Insure your instrument for its full value and ship prepaid. We are not responsible for damage in transit.
- ✓ We do not accept COD shipments or cover any incoming freight or duty charges on returned merchandise
- ✓ Turnaround time on repairs is approximately two weeks.
- ✓ We will call you with an estimate if you specifically request one, or if we determine that the meter may be too costly to repair.
- ✓ Non-warranty repairs will be returned via UPS/COD unless you have already established other payment terms. There is no COD service outside the EU.
- ✓ Payments have to be made by Bank transfer prior to the return shipment. A Proforma invoice will be raised in advance.
- ✓ Warranty repairs will be returned at no charge if shipped within the EU via GLS Ground Service. Freight charges for expedited services (i.e., Federal Express, UPS/2 Day, UPS/1 Day, etc.) are the customer's responsibility and will be charged as per the above terms.

WARRANTY

DELMHORST EUROPE, referred to hereafter as DELMHORST, guarantees your moisture meter for one year from date of purchase and any optional electrodes against defects in material or workmanship for 90 days. If, within the warranty period of the meter, you find any defect in material or workmanship return the meter following the instructions in the “Service for Your Meter” section. This limited warranty does not cover abuse, alteration, misuse, damage during shipment, improper service, unauthorized or unreasonable use of the meter or electrodes. This warranty does not cover batteries, pin assemblies, or pins. If the meter or any optional electrodes have been tampered with, the warranty shall be void. At our option we may replace or repair the meter. DELMHORST shall not be liable for incidental or consequential damages for the breach of any express or implied warranty with respect to this product or its calibration. With proper care and maintenance the meter should stay in calibration; follow the instructions in the “**Care of Your Meter**” section.

Under no circumstances shall DELMHORST be liable for any incidental, indirect, special, or consequential damages of any type whatsoever, including, but not limited to, lost profits or downtime arising out of or related in any respect to the meters or electrodes and no other warranty, written, oral or implied applies. DELMHORST shall in no event be liable for any breach of warranty or defect in this product that exceeds the amount of purchase of this product. The express warranty set forth above constitutes the entire warranty with respect to Delmhorst meters and electrodes and no other warranty, written, oral, or implied applies. This warranty is personal to the customer purchasing the product and is not transferable.

ARTTEST B.V.

Trade name DELMHORST EUROPE
TITANIUMLAAN 100
NL 5221 CK 's-HERTOGENBOSCH
THE NETHERLANDS

info@Delmhorst.eu

www.moisturemetersdelmhorst.com

+31 (0)73 6395080

For 65 years Delmhorst has been the leading manufacturer of high quality moisture meters and thermo-hygrometers. We also offer a wide range of meters for a variety of applications including woodworking/lumber, agriculture, construction, paper, restoration, IAQ and flooring.